



414 Lowell Street  
Wakefield, MA 01880

Phone # 339-219-6393  
Fax # 339-219-6394

eurosportperformance@comcast.net  
www.eurosport-performance.com

Date	Invoice #
4/18/2019	8500

<b>Bill To</b>
CHRIS FRENCH 125 COMMON LANE BEVERLY, MA 978-835-3613

YEAR,MAKE,MODEL	COLOR	MILEAGE	VIN
2009 MERCEDES E63 AMG	BLACK	60890	

Quantity	Description	Rate	Amount
	OIL AND FILTER CHANGE WITH LIQUIMOLY SYNTHETIC OIL - FREE VEHICLE INSPECTION, TOPPED OFF FLUIDS, RESET SERVICE LIGHT	125.00	125.00T
1	REMOVED AND REPLACED AIR SUSPENSION COMPRESSOR ASSEMBLY	370.52	370.52T
1	REMOVED AND REPLACED FRONT AIR SUSPENSION SHOCKS - LEFT AND RIGHT SIDE	1,295.89	1,295.89T
1	(4) NEW MICHELIN PILOT SPORT 4S TIRES - FRONT AND REAR	1,250.75	1,250.75T
1	MOUNT AND BALANCED (4) TIRES	100.00	100.00T
4	TIRE DISPOSAL	3.00	12.00
1	REFINISH FRONT WHEELS AND STRAIGHTENED ALL (4) WHEELS - RIMPRO CHARGES	701.00	701.00
1	REMOVED AND REPLACED LEFT FRONT FENDERLINER	55.11	55.11T
1	REMOVED AND REPLACED FRONT LOWER SPLASH SHIELD	264.20	264.20T
1	FENDERLINER AND SPLASHGUARD HARDWARE	15.00	15.00T

I hereby authorize repair of the above vehicle. I agree that Eurosport Performance is not responsible for loss of articles left in vehicle caused by fire, theft, or any other cause beyond our control or for delays caused by the unavailability of parts or shipping delays. I also grant permission to Eurosport Performance's employees to operate the above stated vehicle for the purpose of testing and or inspection. I understand and agree that to secure payment for the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and further agree to pay reasonable attorney's fees and court costs in the event that legal action becomes necessary to enforce this contract.

<b>Total</b>
--------------



414 Lowell Street  
Wakefield, MA 01880

Phone # 339-219-6393  
Fax # 339-219-6394

eurosportperformance@comcast.net  
www.eurosport-performance.com

Date	Invoice #
4/18/2019	8500

<b>Bill To</b>
CHRIS FRENCH 125 COMMON LANE BEVERLY, MA 978-835-3613

YEAR,MAKE,MODEL	COLOR	MILEAGE	VIN
2009 MERCEDES E63 AMG	BLACK	60890	

Quantity	Description	Rate	Amount
1	REPLACED LEFT FRONT SIDE MARKER BULB, CONNECTOR WITH WIRING REPAIR	29.90	29.90T
1	REMOVED AND REPLACED REAR LICENSE PLATE LIGHT BULB	2.00	2.00T
1	SHOP MATERIALS	12.00	12.00T
1	TOTAL LABOR AND DIAGNOSIS	540.00	540.00
	Sales Tax	6.25%	220.02

I hereby authorize repair of the above vehicle. I agree that Eurosport Performance is not responsible for loss of articles left in vehicle caused by fire, theft, or any other cause beyond our control or for delays caused by the unavailability of parts or shipping delays. I also grant permission to Eurosport Performance's employees to operate the above stated vehicle for the purpose of testing and or inspection. I understand and agree that to secure payment for the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and further agree to pay reasonable attorney's fees and court costs in the event that legal action becomes necessary to enforce this contract.

<b>Total</b>	<b>\$4,993.39</b>
--------------	-------------------



414 Lowell Street  
Wakefield, MA 01880

Phone # 339-219-6393  
Fax # 339-219-6394

eurosportperformance@comcast.net  
www.eurosport-performance.com

Date	Invoice #
7/27/2018	7974

<b>Bill To</b>
CHRIS FRENCH 125 COMMON LANE BEVERLY, MA 978-835-3613

YEAR, MAKE, MODEL	COLOR	MILEAGE	VIN
2009 MERCEDES E63 AMG	BLACK	57800	

Quantity	Description	Rate	Amount
	OIL AND FILTER CHANGE WITH LIQUIMOLY SYNTHETIC OIL - FREE VEHICLE INSPECTION, TOPPED OFF FLUIDS ,RESET SERVICE LIGHT	125.00	125.00T
1	REMOVED AND REPLACED OIL SEPARATOR VALVE WITH TUBE	130.00	130.00T
1	REMOVED AND REPLACED FRONT FOGLAMP ASSEMBLY - LEFT AND RIGHT SIDE (CUSTOMER SUPPLIED PARTS)	0.00	0.00T
1	LABOR	270.00	270.00
	Sales Tax	6.25%	15.94

I hereby authorize repair of the above vehicle. I agree that Eurosport Performance is not responsible for loss of articles left in vehicle caused by fire, theft, or any other cause beyond our control or for delays caused by the unavailability of parts or shipping delays. I also grant permission to Eurosport Performance's employees to operate the above stated vehicle for the purpose of testing and or inspection. I understand and agree that to secure payment for the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and further agree to pay reasonable attorney's fees and court costs in the event that legal action becomes necessary to enforce this contract.

<b>Total</b>	<b>\$540.94</b>
--------------	-----------------

X \_\_\_\_\_





# Action Plan

Prepared For: Chris French

RO# 152879

Year  
2009

Make  
Mercedes-Benz

Model  
E63 AMG

Engine Type  
6.3L V 8 DOHC Naturally  
Aspirated GAS (507)

Date  
10/4/2017

Odometer  
50639.0

VIN #  
WDBUF77X79B363214

License Plate

Advisor:  
Charlie Apple  
capple@crowncars.com

Technician:  
anthony colvin

Crown Eurocars - Mercedes Benz of St Petersburg



- ✔ Power steering fluid (if equipped)
- ✔ Brake fluid
- ✔ Windshield washer fluid
- ✔ Battery state of health
- ✔ Inspect Hood Struts
- ✔ Air filter
- ✔ Cabin air filter
- ✔ Battery condition (cable / clamps / corrosion)
- ✔ Hoses (cracks / damage / leaks)
- ✔ Check for smooth idle and engine performance
- ✔ Check and Adjust Tire Pressures
- ✔ Drive belts (cracks / damage / wear)
- ✔ Check Front Brake Pad Thickness
- ✔ Check Rear Brake Pad Thickness
- ✔ Tire damage / abnormal wear
- ✔ Inspect Wheels for Damage
- ✔ Inspect Engine Mounts
- ✔ Inspect Automatic Transmission Mounts for Damage
- ✔ Check Rear Differential Fluid Level and Condition
- ✔ Inspect Brake System Components (Rotors, Calipers etc.)
- ✔ Inspect Steering Components
- ✔ Inspect Sway Bar Components
- ✔ Exhaust system (damage / leaks / corrosion)
- ✔ Fuel lines and connections / fuel tank bands / fuel tank vapor vent system hoses (damage / leaks / corrosion)
- ✔ Cooling system (leaks)
- ✔ Check Brake System for Leaks
- ✔ Propeller / driveshaft (damage / leaks / U-joints)
- ✔ Suspension (damage / leaks / worn components)
- ✔ Check Engine for Oil Leaks
- ✔ Check Transmission for Leaks
- ✔ Inspect Steering System for Leaks

### Additional Information

Below is information we feel would help you better understand some of the reasons for taking preventive maintenance steps - steps that help ensure the reliability and safety of your vehicle for you and your family. The following section may contain instructions for servicing various components of your vehicles. These are an overview of the process that will be performed by a skilled technician in our shop. They are not intended to be guide for a "do-it-yourself" operation.

### Lens replacement

#### Operation Description

Inspect all exterior lamp assemblies to identify any cracked or broken light lenses. In some cases, the lens portion can be replaced, making the lamp assembly serviceable. Normally the entire lamp assembly needs to be replaced in order to repair a cracked or broken lens.

#### Significance

All vehicle lights are important safety features that allow you to see or to be seen during various driving conditions. A cracked or broken lens allows moisture to enter the lamp, and can cause damage to the light bulb or electrical connector, rendering the lamp useless. Water damage to electrical wiring will allow corrosion to build up and "wick" its way through the wiring harness. This may lead to a very costly repair at a later date. State and federal traffic laws require vehicle lighting to function correctly at all times.

#### Advantage

The safety features of your vehicle require very little maintenance and provide a lot of value to your vehicle. Procrastinating the replacement of a cracked or broken lens will lead to a larger repair later. Generally the repair is less than the time and inconvenience of the traffic stop and possible citation because of a broken lens or inoperative light.


Fail

Pass





Irregular wear due to tire imbalance

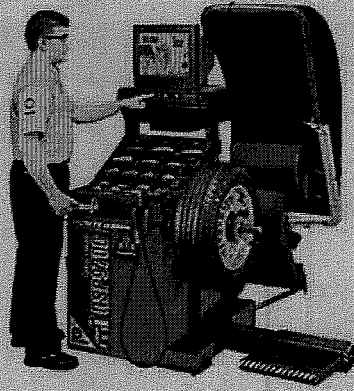

Dynamic tire balancing equipment



0.2x \$152.00					\$389.20
Parts: \$358.80					
2115201522	2115201522		1 @ \$358.80 = \$358.80		

Recommendation Sub-Total \$389.20

Totals, Taxes and Fees

Retail Price

Approved Sub-Total \$0.00

Original Customer Requests Recommendations Subtotal \$0.00

Fail Recommendations Subtotal \$1,004.00

Caution Recommendations Subtotal \$389.20

Shop Supplies \$47.93

Fees \$0.00

Taxes \$100.88

Estimate Total \$1,542.01



# Q Car Care

8 Edwards Road  
Burlington, MA  
Tel: (781) 691-9005



## Invoice to:

Chris French (E63)

## Q Car Care Services Invoice #4630

Invoice date  
22 Apr 2019

Due date  
22 Apr 2019

LLC

Description	Quantity	Unit price	Tax	Amount USD
Q -4 Q Complex Elite Ceramic Coating with Q Car Care at Q Car Care on Mon, Apr 22, 2019 from 11:30AM to 12:00PM	1.0	500.000	N/A	500.00
Paint Correction with Q Car Care at Q Car Care on Mon, Apr 22, 2019 from 11:00AM to 11:30AM	1.0	800.000	MA Sales Tax 0%	800.00
			Includes tax of	0.00
			<b>TOTAL USD</b>	<b>1300.00</b>
			Less amount paid	0.00
			<b>AMOUNT DUE</b>	<b>1300.00</b>

## Payment instructions:


Due upon receipt.  
Thank you for your business!

## Pay this invoice online:

<https://book.gettimely.com/billing/payinvoice/cf6e8bee-cfb5-4ee0-9211-233bf7f61dd>



**Flagship Motorcars**  
 385 Broadway, Rte. 1 North  
 Lynnfield, MA 01940  
 781-596-9700  
 www.herbchambers.com

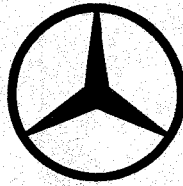


*Our Other Mercedes-Benz Locations:*  
**Mercedes-Benz of Natick**  
 253 North Main Street  
 Natick, MA 01760  
 508-655-5350  
**Mercedes-Benz of Boston**  
 259 McGrath Highway  
 Somerville, MA 02145  
 617-666-4100

**Mercedes-Benz**


CUSTOMER NO. 77194		SERVICE ADVISOR 3729 RENAN MARCHET		TAG NO. T953W		INVOICE DATE 22 Nov 2017		INVOICE NO. 287940	
CHRIS FRENCH 125 COMMON LANE PRIDE CROSSING, MA 01965		HOURLY RATE 0.00		LICENSE NO.		PO NO.		COLOR	
		YEAR/MAKE/MODEL 09 MERCEDES-BENZ E63AMG		MILEAGE IN 52170		MILEAGE OUT 52180		NO. STOCK / STOCK NO.	
		VEHICLE IDENTIFICATION NO. WDBUF77X79B363214		DELIVERY DATE 30 Oct 2017		IN SERVICE DATE			
EMAIL ADDRESS		CELL PHONE		SALES PERSON		R.O. DATE 20 Nov 2017		WAR EXP. 30 Oct 2017	
TEL HOME 978-835-3613		TEL BUSINESS EXT.		COMMENTS ENG:5.0_Liter 7					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A							
CUSTOMER STATES THAT RIGHT UPPER BALL JOINT IS WORN AND IS MAKING CAR							
PULL HARD RIGHT							
10			DRIVEABILITY				
			3754 CPM			145.00	145.00
	1	000-330-10-07	RS TRANSVERSE CONTROL ARM		107.50	107.50	107.50
PARTS:			107.50	LABOR:	145.00	OTHER:	0.00
REPLACED THE RIGHT FRONT UPPER BALL JOINT. ROAD TESTED CAR AND THE CAR IS FINE NOW					TOTAL LINE A: 252.50		
*****							
C							
CUSTOMER REQUEST PRICES FOR FOUR NEW TIRES							
46			WHEEL/TIRES				
			3754 ISP				(N/C)
PARTS:			0.00	LABOR:	0.00	OTHER:	0.00
GAVE CUSTOMER ESTIMATE					TOTAL LINE C: 0.00		
*****							
ENVIRONMENTAL COMPLIANCE CHARGE							18.94

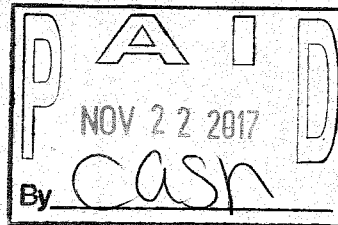

<input type="checkbox"/> CASH <input type="checkbox"/> CHECK CK NO. [      ] <input type="checkbox"/> VISA <input type="checkbox"/> MASTERCARD <input type="checkbox"/> AMEX <input type="checkbox"/> CHARGE <input type="checkbox"/> OTHER		<table border="1"> <thead> <tr> <th>DESCRIPTION</th> <th>TOTALS</th> </tr> </thead> <tbody> <tr> <td>LABOR AMOUNT</td> <td>\$ 145.00</td> </tr> <tr> <td>PARTS</td> <td>\$ 107.50</td> </tr> <tr> <td>GAS, OIL, LUBE</td> <td>\$ 0.00</td> </tr> <tr> <td>SUBLET REPAIRS</td> <td>\$ 0.00</td> </tr> <tr> <td>MISCELLANEOUS CHARGES</td> <td>\$ 18.94</td> </tr> <tr> <td>TOTAL CHARGES</td> <td>\$ 271.44</td> </tr> <tr> <td>LESS DISCOUNT/INSURANCE</td> <td>\$ 0.00</td> </tr> <tr> <td>SALES TAX</td> <td>\$ 6.72</td> </tr> <tr> <td><b>PLEASE PAY THIS AMOUNT</b></td> <td><b>\$ 278.16</b></td> </tr> </tbody> </table>	DESCRIPTION	TOTALS	LABOR AMOUNT	\$ 145.00	PARTS	\$ 107.50	GAS, OIL, LUBE	\$ 0.00	SUBLET REPAIRS	\$ 0.00	MISCELLANEOUS CHARGES	\$ 18.94	TOTAL CHARGES	\$ 271.44	LESS DISCOUNT/INSURANCE	\$ 0.00	SALES TAX	\$ 6.72	<b>PLEASE PAY THIS AMOUNT</b>	<b>\$ 278.16</b>
DESCRIPTION	TOTALS																					
LABOR AMOUNT	\$ 145.00																					
PARTS	\$ 107.50																					
GAS, OIL, LUBE	\$ 0.00																					
SUBLET REPAIRS	\$ 0.00																					
MISCELLANEOUS CHARGES	\$ 18.94																					
TOTAL CHARGES	\$ 271.44																					
LESS DISCOUNT/INSURANCE	\$ 0.00																					
SALES TAX	\$ 6.72																					
<b>PLEASE PAY THIS AMOUNT</b>	<b>\$ 278.16</b>																					
THANK YOU FOR CHOOSING FLAGSHIP MOTORCARS  _____ Customer Signature  Environmental Compliance <small>Federal and state laws require that all hazardous waste (oil, solvents, anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner. Any charges for environmental compliance reflect our conformity to federal and state law in addition to our concern for the preservation of the environment.</small>																						

**Flagship Motorcars**  
 385 Broadway, Rte. 1 North  
 Lynnfield, MA 01940  
 781-596-9700  
 www.herbchambers.com

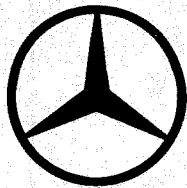


Our Other Mercedes-Benz Locations:

**Mercedes-Benz of Natick**      **Mercedes-Benz of Boston**  
 253 North Main Street      259 McGrath Highway  
 Natick, MA 01760      Somerville, MA 02145  
 508-655-5350      617-666-4100

**Mercedes-Benz**

CUSTOMER NO. 77194		SERVICE ADVISOR 3729 RENAN MARCHET		TAG NO. T412W		INVOICE DATE 02 Jul 2018		INVOICE NO. 305276	
CHRIS FRENCH 125 COMMON LANE PRIDE CROSSING, MA 01965		HOURLY RATE 0.00		LICENSE NO.		COLOR		NO. STOCK / STOCK NO.	
EMAIL ADDRESS		YEAR/MAKE/MODEL 09 MERCEDES BENZ E63AMG		MILEAGE IN 56496		MILEAGE OUT 56496		IN SERVICE DATE	
TEL HOME 978-835-3613		CELL PHONE		SALES PERSON		DELIVERY DATE 30 Oct 2017		R.O. DATE 28 Jun 2018	
TEL BUSINESS EXT.		VEHICLE IDENTIFICATION NO. WDBUF77X79B363214		R.O. DATE 28 Jun 2018		WAR EXP. 30 Oct 2017		COMMENTS ENG:5.0_Liter 8	


LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A							
A CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON							
CEL CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON							
				3917		506.00	506.00
				1	156-906-44-00	81.00	50.00
				8	004-159-39-03	22.50	14.85
PARTS:				168.80	LABOR:	506.00	0.00
					OTHER:	0.00	0.00
						TOTAL LINE A:	674.80
PERFORMED TEST FOUND CODE FOR MISFIRE ON CYL #5 . REPLACE #5							
IGNITION COIL AND ALL SPARK PLUG, CLEAR FAULT , ROAD TEST OK							
*****							
B							
B CUSTOMER STATES THAT VEHICLE IS VIBRATING AT HIGHWAY SPEEDS							
				10	DRIVEABILITY		
				3917	CPM		0.00
PARTS:				0.00	LABOR:	0.00	0.00
					OTHER:	0.00	0.00
						TOTAL LINE B:	0.00
ALL WHEEL BENT							
*****							
C							
C CUSTOMER REQUEST OIL TOP OFF							
				00	QUICK SERVICE		
				3917	CPM		0.00
PARTS:				0.00	LABOR:	0.00	0.00
					OTHER:	0.00	0.00
						TOTAL LINE C:	0.00
TOP ALL FLUID							
*****							
D							
D LOANER CAR							
				999	ILS		(N/C)
PARTS:				0.00	LABOR:	0.00	0.00
					OTHER:	0.00	0.00
						TOTAL LINE D:	0.00
*****							
ENVIRONMENTAL COMPLIANCE CHARGE							
							28.75

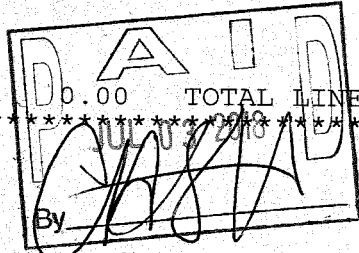

<input type="checkbox"/> CASH <input type="checkbox"/> CHECK CK NO. [      ] <input type="checkbox"/> VISA <input type="checkbox"/> MASTERCARD <input type="checkbox"/> AMEX <input type="checkbox"/> CHARGE <input type="checkbox"/> OTHER		<table border="1"> <thead> <tr> <th>DESCRIPTION</th> <th>TOTALS</th> </tr> </thead> <tbody> <tr> <td>LABOR AMOUNT</td> <td>\$ 506.00</td> </tr> <tr> <td>PARTS</td> <td>\$ 168.80</td> </tr> <tr> <td>GAS, OIL, LUBE</td> <td>\$ 0.00</td> </tr> <tr> <td>SUBLET REPAIRS</td> <td>\$ 0.00</td> </tr> <tr> <td>MISCELLANEOUS CHARGES</td> <td>\$ 28.75</td> </tr> <tr> <td>TOTAL CHARGES</td> <td>\$ 703.55</td> </tr> <tr> <td>LESS DISCOUNT/INSURANCE</td> <td>\$ 0.00</td> </tr> <tr> <td>SALES TAX</td> <td>\$ 10.55</td> </tr> <tr> <td><b>PLEASE PAY THIS AMOUNT</b></td> <td><b>\$ 714.10</b></td> </tr> </tbody> </table>	DESCRIPTION	TOTALS	LABOR AMOUNT	\$ 506.00	PARTS	\$ 168.80	GAS, OIL, LUBE	\$ 0.00	SUBLET REPAIRS	\$ 0.00	MISCELLANEOUS CHARGES	\$ 28.75	TOTAL CHARGES	\$ 703.55	LESS DISCOUNT/INSURANCE	\$ 0.00	SALES TAX	\$ 10.55	<b>PLEASE PAY THIS AMOUNT</b>	<b>\$ 714.10</b>
DESCRIPTION	TOTALS																					
LABOR AMOUNT	\$ 506.00																					
PARTS	\$ 168.80																					
GAS, OIL, LUBE	\$ 0.00																					
SUBLET REPAIRS	\$ 0.00																					
MISCELLANEOUS CHARGES	\$ 28.75																					
TOTAL CHARGES	\$ 703.55																					
LESS DISCOUNT/INSURANCE	\$ 0.00																					
SALES TAX	\$ 10.55																					
<b>PLEASE PAY THIS AMOUNT</b>	<b>\$ 714.10</b>																					
THANK YOU FOR CHOOSING FLAGSHIP MOTORCARS  _____ Customer Signature  Environmental Compliance Federal and state laws require that all hazardous waste (oil, solvents, anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner. Any charges for environmental compliance reflect our conformity to federal and state law in addition to our concern for the preservation of the environment.																						



**Flagship Motorcars**  
 385 Broadway, Rte. 1 North  
 Lynnfield, MA 01940  
 781-596-9700  
 www.herbchambers.com

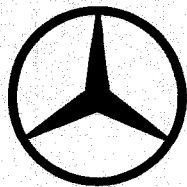

**Our Other Mercedes-Benz Locations:**

**Mercedes-Benz of Natick**  
 253 North Main Street  
 Natick, MA 01760  
 508-655-5350

**Mercedes-Benz of Boston**  
 259 McGrath Highway  
 Somerville, MA 02145  
 617-666-4100

**Mercedes-Benz**

CUSTOMER NO. 77194		SERVICE ADVISOR 3729 RENAN MARCHET		TAG NO. T101W	INVOICE DATE 31 Oct 2017	INVOICE NO. 286169
CHRIS FRENCH 125 COMMON LANE PRIDE CROSSING, MA 01965		HOURLY RATE 0.00	LICENSE NO.	PO NO.	COLOR	NO. STOCK / STOCK NO.
		YEAR/MAKE/MODEL 09 MERCEDES-BENZ E63AMG			MILEAGE IN 51389	MILEAGE OUT 51389
		VEHICLE IDENTIFICATION NO. WDBUF77X79B363214			DELIVERY DATE 30 Oct 2017	IN SERVICE DATE
EMAIL ADDRESS		CELL PHONE	SALES PERSON		R.O. DATE 30 Oct 2017	WAR EXP. 30 Oct 2017
TEL HOME 978-835-3613	TEL BUSINESS EXT.	COMMENTS ENG:5.0_Liter 7				

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL  
 A PERFORM MAINTENANCE SERVICE A PER CUSTOMERS REQUEST, CUSTOMER WANTS A  
 LIST OF WHAT IT NEEDS TO PASS INSPECTION  
 CAUSE: PERFORMED A-SERVICE-INSPECT ALL LAMPS/HORN FUNCTIONS-INSPECT ALL  
 SAFETY EQUIPMENT FOR PROPER FUNCTION-PERFORMED LUBE,OIL &  
 FILTER CHANGE, TOP OFF ALL FLUID-INSPECT ENGINE BELT FOR  
 WEAR-PERFORMED BRAKE & TIRE INSPECTION & CORRECT ALL  
 PRESSURES-RESET SE  
 A PERFORM MAINTENANCE SERVICE A PER CUSTOMERS  
 REQUEST  
 3709 CPMM 236.02 236.02  
 1 000-180-30-09 FILTER ELEMENT 25.50 25.50 25.50  
 10 000-989-83-01-USB9 MB GENUINE ENGINE OIL 5.99 5.39 53.90  
 5W-40 MB 229.5  
 PARTS: 79.40 LABOR: 236.02 OTHER: 0.00 TOTAL LINE A: 315.42


PERFORMED A-SERVICE-INSPECT ALL LAMPS/HORN FUNCTIONS-INSPECT ALL  
 SAFETY EQUIPMENT FOR PROPER FUNCTION-PERFORMED LUBE,OIL & FILTER  
 CHANGE, TOP OFF ALL FLUID-INSPECT ENGINE BELT FOR WEAR-PERFORMED BRAKE &  
 TIRE INSPECTION & CORRECT ALL PRESSURES-RESET SERVICE INDICATOR-WASH &  
 VACUUM VEHICLE  
 \*\*\*\*\* PAID \*\*\*\*\* CASH 600  
 B CLIENT REQUESTS WIPER BLADES WIPERBLADES CLIENT REQUESTS WIPER BLADES  
 3709 CPM 19.95 19.95  
 1 211-820-29-45 TS WIPER BLADE 51.00 51.00 51.00  
 PARTS: 51.00 LABOR: 19.95 OTHER: 0.00 TOTAL LINE B: 70.95  
 REPLACE WIPER BLADES, ENSURE PROPER CONTACT WITH WINDSHIELD

\*\*\*\*\*  
 C CUSTOMER STATES THAT LEFT WASHERFLUID INJECTOR IS INOP, RIGHT WORKS  
 00 QUICK SERVICE 3709 CPM 73.00 73.00  
 1 211-860-11-47 NOZZLE 76.25 76.25 76.25  
 PARTS: 76.25 LABOR: 73.00 OTHER: 0.00 TOTAL LINE C: 149.25  
 REMOVE AND REPLACE WASHER NOZZLE AND TEST IT=OK.  
 \*\*\*\*\*

<input type="checkbox"/> CASH <input type="checkbox"/> CHECK CK NO. [    ] <input type="checkbox"/> VISA <input type="checkbox"/> MASTERCARD <input type="checkbox"/> AMEX <input type="checkbox"/> CHARGE <input type="checkbox"/> OTHER		DESCRIPTION	TOTALS
THANK YOU FOR CHOOSING FLAGSHIP MOTORCARS  _____ Customer Signature  Environmental Compliance Federal and state laws require that all hazardous waste (oil, solvents, anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner. Any charges for environmental compliance reflect our conformity to federal and state law in addition to our concern for the preservation of the environment.		LABOR AMOUNT	
		PARTS	
		GAS, OIL, LUBE	
		SUBLET REPAIRS	
		MISCELLANEOUS CHARGES	
		TOTAL CHARGES	
		LESS DISCOUNT/INSURANCE	
SALES TAX			
		PLEASE PAY THIS AMOUNT	

# Flagship Motorcars

385 Broadway, Rte. 1 North  
Lynnfield, MA 01940  
781-596-9700  
www.herbchambers.com

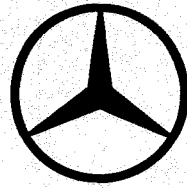

### Our Other Mercedes-Benz Locations:

Mercedes-Benz of Natick  
253 North Main Street  
Natick, MA 01760  
508-655-5350

Mercedes-Benz of Boston  
259 McGrath Highway  
Somerville, MA 02145  
617-666-4100

# Mercedes-Benz

CUSTOMER NO. 77194	SERVICE ADVISOR 3729 RENAN MARCHET	TAG NO. T101W	INVOICE DATE 31 Oct 2017	INVOICE NO. 286169
CHRIS FRENCH 125 COMMON LANE PRIDE CROSSING, MA 01965	HOURLY RATE 0.00	LICENSE NO.	COLOR	NO. STOCK / STOCK NO.
	YEAR/MAKE/MODEL 09 MERCEDES-BENZ E63AMG		MILEAGE IN 51389	MILEAGE OUT 51389
	VEHICLE IDENTIFICATION NO. WDBUF77X79B363214		DELIVERY DATE 30 Oct 2017	IN SERVICE DATE
	EMAIL ADDRESS	CELL PHONE	SALES PERSON	R.O. DATE 30 Oct 2017
TEL HOME 978-835-3613	TEL BUSINESS EXT.	COMMENTS ENG:5.0_Liter 7	WAR EXP. 30 Oct 2017	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
D							
LOANER LOANER CAR							
999 ILS (N/C)							
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE D:	0.00
*****							
E** BRAKE SYSTEM FLUSH REQUESTED							
BRAKEFLUSH BRAKE SYSTEM FLUSH REQUESTED							
3709 CPMM							
	1	000-989-08-07-01	BRAKE FLUID	22.00	139.00	139.00	
PARTS:	22.00	LABOR:	139.00	OTHER:	0.00	TOTAL LINE E:	161.00
PERFORMED BRAKE SYSTEM FLUID FLUSH-REGULATE FLUID LEVEL/OK							
*****							
F** ENGINE AIR FILTER REPLACEMENT REQUESTED							
ENGINEAIRFILTER ENGINE AIR FILTER REPLACEMENT REQUESTED							
3709 CPMM							
	1	156-094-05-04	FILTER ELEMENT	79.80	69.50	69.50	
PARTS:	79.80	LABOR:	69.50	OTHER:	0.00	TOTAL LINE F:	149.30
REMOVE/REPLACE ENGINE AIR FILTER-CLEAR DEBRIS OUT OF AIRBOX							
*****							
ENVIRONMENTAL COMPLIANCE CHARGE							28.75

CASH                       CHECK CK NO. [       ]  
 VISA                          MASTERCARD  
 AMEX                          CHARGE                       OTHER

DESCRIPTION	TOTALS
LABOR AMOUNT	\$ 537.47
PARTS	\$ 308.45
GAS, OIL, LUBE	\$ 0.00
SUBLET REPAIRS	\$ 0.00
MISCELLANEOUS CHARGES	\$ 28.75
TOTAL CHARGES	\$ 874.67
LESS DISCOUNT/INSURANCE	\$ 0.00
SALES TAX	\$ 19.28
<b>PLEASE PAY THIS AMOUNT</b>	<b>\$ 893.95</b>

THANK YOU FOR CHOOSING FLAGSHIP MOTORCARS

\_\_\_\_\_  
 Customer Signature  
 Environmental Compliance  
Federal and state laws require that all hazardous waste (oil, solvents, anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner. Any charges for environmental compliance reflect our conformity to federal and state law in addition to our concern for the preservation of the environment.

385 Broadway

Lynnfield Massachusetts 01940


7815969700

Customer information

Street:

Zip code:

Cardholder Signature

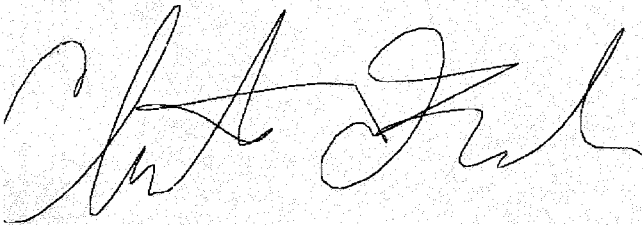

ENCH CHRISTOPHER T

Transaction information

Sale  
Date: 10/31/2017 2:16 PM  
Merchant ID: 12721865  
Terminal ID: 00000001  
Invoice No.: 286169  
Amount: \$293.95  
Card Number: \*\*\*\*\*3876  
Response Msg: Approved  
Auth Code: 141966  
Auth Mode: Issuer  
Application Name: VISA DEBIT  
Processed as: VISA  
Entry Method: Chip Read  
Trace No.: 730418200496  
Reference No.: 1538218695  
Match AVS: Not Present  
Match ZIP: Not Present  
Match CVV: Not Present  
Chip Card AID: A0000000031010  
TVR: 8000008000  
IAD: 06010A03600000  
TSI: 6800  
ARC:  
User ID: relshrafi

I Agree to Pay Above Total Amount According to Card Issuer Agreement (Merchant Agreement if Credit Voucher).

Merchant / Customer Copy




304845

Promised:17:00 23JUN18

\*INVOICE\*

Flagship Motorcars
385 Broadway, Rte. 1 North
Lynnfield, MA 01940
781-596-9700
www.herbchambers.com

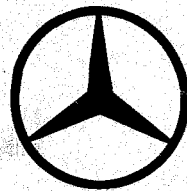

Our Other Mercedes-Benz Locations:



Mercedes-Benz of Natick
253 North Main Street
Natick, MA 01760
508-655-5350

Mercedes-Benz of Boston
259 McGrath Highway
Somerville, MA 02145
617-666-4100

Mercedes-Benz

Customer information form including fields for Customer No. (77194), Service Advisor (3729 RENAN MARCHET), TAG No. (T832W), Invoice Date (25 Jun 2018), Invoice No. (304845), and Customer Name (CHRIS FRENCH).

Table with columns: LINE OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Contains work order details for 'A TOW IN' and 'B CUSTOMER STATES THAT THE BELT IS BROKEN'.

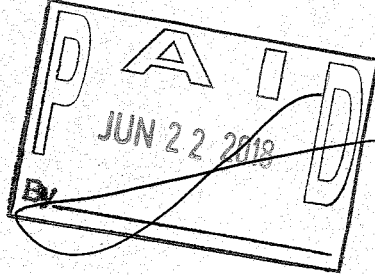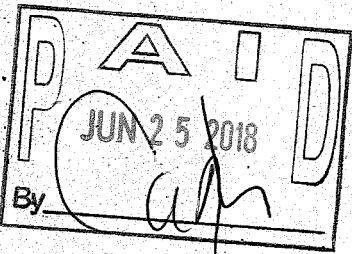

Payment method selection (CASH, CHECK, VISA, MASTERCARD, AMEX, CHARGE, OTHER) and signature line with 'THANK YOU FOR CHOOSING FLAGSHIP MOTORCARS' message.

Summary table with columns: DESCRIPTION, TOTALS. Lists items like LABOR AMOUNT (\$154.00), PARTS (\$95.00), and a final total of \$273.62.



414 Lowell Street  
Wakefield, MA 01880

Phone # 339-219-6393      eurosportperformance@comcast.net  
Fax # 339-219-6394      www.eurosport-performance.com

Date	Invoice #
6/10/2020	9317

Bill To
CHRIS FRENCH 125 COMMON LANE BEVERLY, MA 978-835-3613

YEAR, MAKE, MODEL	COLOR	MILEAGE	VIN
2009 MERCEDES E63	BLACK	68390	

Quantity	Description	Rate	Amount
1	REMOVED AND REPLACED FRONT LOWER UNDERSHIELDING - MIDDLE AND REAR	236.61	236.61T
1	UNDERSHIELDING HARDWARE, CLIPS, SCREWS	48.87	48.87T
1	REMOVED LEFT FRONT CATALYTIC CONVERTER ASSEMBLY, REWELDED BROKEN CASING OF CATALYST PIPE, INSTALLED CATALYTIC CONVERTER ASSEMBLY	0.00	0.00T
1	CUT AND REWELDED EXHAUST PIPE ON CENTER SECTION OF EXHAUST SYSTEM	0.00	0.00T
1	SHOP MATERIALS	54.95	54.95T
1	LABOR AND WELDING	600.00	600.00
	Sales Tax	6.25%	21.28

I hereby authorize repair of the above vehicle. I agree that Eurosport Performance is not responsible for loss of articles left in vehicle caused by fire, theft, or any other cause beyond our control or for delays caused by the unavailability of parts or shipping delays. I also grant permission to Eurosport Performance's employees to operate the above stated vehicle for the purpose of testing and or inspection. I understand and agree that to secure payment for the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and further agree to pay reasonable attorney's fees and court costs in the event that legal action becomes necessary to enforce this contract.

<b>Total</b>	<b>\$961.71</b>
--------------	-----------------

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE

# EUROSPORT PERFORMANCE, INC.

414 Lowell St.  
Wakefield, MA 01880  
Phone (339) 219-6393

000045

NAME: Chris French DATE: 6/1/08  
 ADDRESS: 125 Common Ave  
 CITY: Beverly MA PHONE WHEN READY: ? 978-835-3618  
 YEAR: 09 TYPE OR MODEL: Mercury E63 MOTOR NO.: SERIAL NUMBER: LICENSE NUMBER: ODOMETER: 72444

REPAIR ORDER - LABOR INSTRUCTIONS

LUBRICATE  CHANGE OIL  FLUSH TRANS.  FLUSH DIFF.  WASH  POLISH

oil & filter change - motor synthetic  
 oil - topped off fluids, reset tire pressures  
 reset service light

removed & replaced front fuse box with  
 signal acquisition module - code & programmed  
 control unit with scan tool

removed & repaired sunroof motor  
 performed sunroof adaptation  
 to remove open/close stops.

RETAIN PARTS  DESTROY PARTS

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH NECESSARY MATERIALS YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK AN EXPRESS MECHANIC'S LEND IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERE TO YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT OR ANY OTHER CAUSE BEYOND YOUR CONTROL.

AUTHORIZED BY: 

GAL. GASOLINE	QTS. OIL	LBS. GREASE	TOTAL GAS - OIL - GREASE	TOTAL LABOR	TOTAL PARTS	TOTAL AMOUNT
0	0	0	0	800	1226	2026
						MA STATE TAX
						65.68
						<b>TOTAL AMOUNT</b>

QUAN.	PART NO.	DESCRIPTION	SALE AMOUNT
-		oil synthetic - motor	81-
-		oil filter	14.50-
-		oil pan - plug washer	1.50-
-		Repl sunroof motor	468-
-		Repl front fuse box with signal acquisition module	486-
		Repl battery	175-
		SPECIAL REPAIRS	1226
TOTAL PARTS			
ESTIMATE AMOUNT			
ADD'L AUTH. AMT.	TIME	PARTS	
ADD'L AUTH. AMT.	BY	LABOR	
ADD'L AUTH. AMT.			
<b>ESTIMATE TOTAL</b>			

Unless otherwise provided by law, the seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

3091.68





414 Lowell Street  
Wakefield, MA 01880

Phone # 339-219-6393  
Fax # 339-219-6394

eurosportperformance@comcast.net  
www.eurosport-performance.com

Date	Invoice #
11/13/2020	9687

Bill To
CHRIS FRENCH 125 COMMON LANE BEVERLY, MA 978-835-3613


YEAR,MAKE,MODEL	COLOR	MILEAGE	VIN
2009 MERCEDES E63 AMG	BLACK	70860	

Quantity	Description	Rate	Amount
1	OIL AND FILTER CHANGE WITH LIQUIMOLY SYNTHETIC OIL - FREE VEHICLE INSPECTION, TOPPED OFF FLUIDS, RESET SERVICE LIGHT	125.00	125.00T
1	REFINISHED , PREP AND PAINTED RIGHT SIDE FRONT AND REAR WHEELS	250.00	250.00T
1	MOUNT AND BALANCED (2) WHEELS/TIRES - RIGHT SIDE - RESET TIRE PRESSURES AND TPM SYSTEM	40.00	40.00T
1	TIRE DISPOSAL FEE	5.00	5.00
1	SHOP MATERIALS	6.00	6.00T
1	(1) NEW MICHELIN PILOT SPORT 4S - RIGHT FRONT	210.50	210.50T
1	LABOR	100.00	100.00
	Sales Tax	6.25%	39.47

I hereby authorize repair of the above vehicle. I agree that Eurosport Performance is not responsible for loss of articles left in vehicle caused by fire, theft, or any other cause beyond our control or for delays caused by the unavailability of parts or shipping delays. I also grant permission to Eurosport Performance's employees to operate the above stated vehicle for the purpose of testing and or inspection. I understand and agree that to secure payment for the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and further agree to pay reasonable attorney's fees and court costs in the event that legal action becomes necessary to enforce this contract.

<b>Total</b>	<b>\$775.97</b>
--------------	-----------------

**Flagship Motorcars**  
 385 Broadway, Rte. 1 North  
 Lynnfield, MA 01940  
 781-596-9700  
 www.herbchambers.com

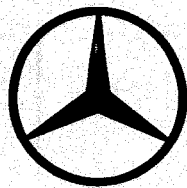

**Our Other Mercedes-Benz Locations:**  
**Mercedes-Benz of Natick**  
 253 North Main Street  
 Natick, MA 01760  
 508-655-5350  
**Mercedes-Benz of Boston**  
 259 McGrath Highway  
 Somerville, MA 02145  
 617-666-4100

**Mercedes-Benz**

CUSTOMER NO. 77194		SERVICE ADVISOR 3729 RENAN MARCHET	TAG NO. T227W	INVOICE DATE 29 Nov 2017	INVOICE NO. 288619
CHRIS FRENCH 125 COMMON LANE PRIDE CROSSING, MA 01965		HOURLY RATE 0.00	LICENSE NO.	COLOR	NO. STOCK / STOCK NO.
EMAIL ADDRESS		YEAR/MAKE/MODEL 09 MERCEDES-BENZ E63AMG	PO NO.	MILEAGE IN 57658	MILEAGE OUT 57658
TEL HOME 978-835-3613		VEHICLE IDENTIFICATION NO. WDBUF77X79B363214	SALES PERSON	DELIVERY DATE 30 Oct 2017	IN SERVICE DATE
TEL BUSINESS EXT.		CELL PHONE	R.O. DATE 29 Nov 2017	WAR EXP. 30 Oct 2017	
COMMENTS ENG:5.0_Liter 7					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A CUSTOMER REQUEST REPLACEMENT OF ALL FOUR TIRES THAT HAVE BEEN ORDERED							
				MB4 MOUNT & BALANCE 4 TIRES-RESET PRESSURES		159.95	159.95
				3754 CPM			
				2 Q-8-40-2320 CONTINENTAL 245/40R18 SKU, 0357915, 97Y,	256.00	245.22	490.44
				2 Q-8-40-2322 CONTINENTAL 265/35R18 SKU, 0357920, 97Y,	280.00	268.40	536.80
				8 WWT WEIGHT	2.50	2.50	20.00
				1 012-401-01-13 VALVE	34.20	34.20	34.20
				1 000-401-09-14 CONNECTOR	19.95	19.95	19.95
PARTS: 1101.39 LABOR: 159.95 OTHER: 0.00					TOTAL LINE A:		1261.34

REPLACED ALL FOUR TIRES AND THE RIGHT REAR VALVE STEM THE CAR IS FINE NOW

\*\*\*\*\*

B CUSTOMER STATES THAT CHECK OIL AT NEXT REFUELING LIGHT IS ON

00 QUICK SERVICE


3754 ISP (N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

THE OIL LEVEL IS FINE

\*\*\*\*\*

ENVIRONMENTAL COMPLIANCE CHARGE 28.75

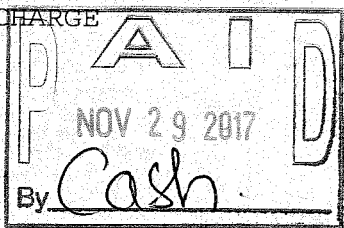

<input type="checkbox"/> CASH <input type="checkbox"/> VISA <input type="checkbox"/> AMEX <input type="checkbox"/> CHECK CK NO. [ ] <input type="checkbox"/> MASTERCARD <input type="checkbox"/> CHARGE <input type="checkbox"/> OTHER	<table border="1"> <thead> <tr> <th>DESCRIPTION</th> <th>TOTALS</th> </tr> </thead> <tbody> <tr> <td>LABOR AMOUNT</td> <td>\$ 159.95</td> </tr> <tr> <td>PARTS</td> <td>\$ 1101.39</td> </tr> <tr> <td>GAS, OIL, LUBE</td> <td>\$ 0.00</td> </tr> <tr> <td>SUBLET REPAIRS</td> <td>\$ 0.00</td> </tr> <tr> <td>MISCELLANEOUS CHARGES</td> <td>\$ 28.75</td> </tr> <tr> <td>TOTAL CHARGES</td> <td>\$ 1290.09</td> </tr> <tr> <td>LESS DISCOUNT/INSURANCE</td> <td>\$ 0.00</td> </tr> <tr> <td>SALES TAX</td> <td>\$ 68.84</td> </tr> <tr> <td>PLEASE PAY THIS AMOUNT</td> <td>\$ <del>1358.93</del></td> </tr> </tbody> </table>	DESCRIPTION	TOTALS	LABOR AMOUNT	\$ 159.95	PARTS	\$ 1101.39	GAS, OIL, LUBE	\$ 0.00	SUBLET REPAIRS	\$ 0.00	MISCELLANEOUS CHARGES	\$ 28.75	TOTAL CHARGES	\$ 1290.09	LESS DISCOUNT/INSURANCE	\$ 0.00	SALES TAX	\$ 68.84	PLEASE PAY THIS AMOUNT	\$ <del>1358.93</del>
DESCRIPTION	TOTALS																				
LABOR AMOUNT	\$ 159.95																				
PARTS	\$ 1101.39																				
GAS, OIL, LUBE	\$ 0.00																				
SUBLET REPAIRS	\$ 0.00																				
MISCELLANEOUS CHARGES	\$ 28.75																				
TOTAL CHARGES	\$ 1290.09																				
LESS DISCOUNT/INSURANCE	\$ 0.00																				
SALES TAX	\$ 68.84																				
PLEASE PAY THIS AMOUNT	\$ <del>1358.93</del>																				
THANK YOU FOR CHOOSING FLAGSHIP MOTORCARS _____ Customer Signature Environmental Compliance Federal and state laws require that all hazardous waste (oil, solvents, anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner. Any charges for environmental compliance reflect our conformity to federal and state law in addition to our concern for the preservation of the environment.																					

\$ 1208.93



CUSTOMER #: 240373

152879



Chris French
1145 81ST ST S
ST PETE, FL 33707
HOME: 727-238-2580 CONT: 727-238-2580
BUS: CELL:

\*INVOICE\*

6001 34th Street North (US 19) · St. Petersburg, FL 33714
Phone 727-527-5731 · Fax 727-521-4489
www.CrownCars.com

PAGE 1

Repair Shop Registration Number: MV-03688

SERVICE ADVISOR: 977714 CHARLES NORMAN APP

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes vehicle details for a 2009 Mercedes Benz E-Class.

Table with columns: R.O. OPENED, READY, OPTIONS, LIST, NET, TOTAL. Includes time entries for 03OCT17.

B Pre Purchase inspection for a vehicle that the dealer is going to bring there, dealer will be dropping off the car and the results will be sent back to me.

R REPAIR

Summary table for repair: 977268 C, 304.00, 304.00. PARTS: 0.00 LABOR: 304.00 OTHER: 0.00 TOTAL LINE B: 304.00

50646 performed pre-purchase inspection. please see MIP for notes

\*\*\*\*\*

CUSTOMER PAY SHOP SUPPLIES FOR REPAIR ORDER

30.40

Chip from Private Allstar cars will be dropping off a 2009 MB E63 for a pre purchase inspection, I had scheduled an appointment last week but the dealer was unable to bring the vehicle in until tomorrow 10/03/17. When all set please give me a call wi

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PERFORMED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE...

\*SHOP SUPPLY COSTS: We have added a charge equal to 10% of the total cost of labor and parts, not to exceed \$50.00, to the Repair Order. This charge represents costs and profits to the motor vehicle repair facility for miscellaneous shop supplies and waste disposal.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

Table with columns: DATE, CUSTOMER SIGNATURE, AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE, DESCRIPTION, TOTALS. Includes 'PLEASE PAY THIS AMOUNT' 357.80.

Section 501.98, Florida Statutes, requires that, at least 30 days before bringing any claim against a motor vehicle dealer for an unfair or deceptive trade practice, a consumer must provide the dealer with a written demand letter stating the name, address, and telephone number of the consumer; the name and address of the dealer; a description of the facts that serve as the basis for the claim; the amount of damages; and copies of any documents in the possession of the consumer which relate to the claim.

X

Crown Eurocars, Inc.  
6001 34th St N.  
St. Petersburg , FL 33714  
(866) 369-3751

RECEIPT

**Customer Information:**

Chris French

**Invoice Details:**

Invoice #: UMLU6O65FP

Invoice Date: Wednesday, October 04, 2017 12:30  
PM

XXX65

(XXX) XXX-X613

Repair Order/Ref #: 152879

---

**Description of Product/Services**

**Amount**

Please see the attached invoice.

\$ 357.80

---

**Payment Details:**

Paid On: Wednesday, October 04, 2017 12:46

PM

Credit Card: XXXXXXXXXXXXX3876 exp XX

/XXXX

Card Type: Visa

Cardholder Name: Christopher T French

Payment Type: Online

Confirmation #: 104269

Charlie Apple

-----  
Customer Signature

THANK YOU!

---

Crown Eurocars, Inc.

Processed by myKaarma eBridge Payments





414 Lowell Street  
Wakefield, MA 01880

Phone # 339-219-6393      eurosportperformance@comcast.net  
Fax # 339-219-6394      www.eurosport-performance.com

Date	Invoice #
5/4/2020	9241

Bill To
CHRIS FRENCH 125 COMMON LANE BEVERLY, MA 978-835-3613

YEAR, MAKE, MODEL	COLOR	MILEAGE	VIN
2009 MERCEDES E63	BLACK	66800	

Quantity	Description	Rate	Amount
	OIL AND FILTER CHANGE WITH LIQUIMOLY SYNTHETIC OIL - FREE VEHICLE INSPECTION, TOPPED OFF FLUIDS, RESET SERVICE LIGHT	125.00	125.00T
1	REMOVED AND REPLACED (4) IGNITION COILS - RIGHT SIDE	245.95	245.95T
1	REMOVED AND REPLACED (8) SPARK PLUGS	112.39	112.39T
1	REMOVED AND REPLACED COOLANT EXPANSION TANK	45.62	45.62T
1	1 GALLON OF COOLANT	21.50	21.50T
1	REMOVED AND REPLACED SERPENTINE BELT	52.10	52.10T
1	LABOR	250.00	250.00
	Sales Tax	6.25%	37.66

I hereby authorize repair of the above vehicle. I agree that Eurosport Performance is not responsible for loss of articles left in vehicle caused by fire, theft, or any other cause beyond our control or for delays caused by the unavailability of parts or shipping delays. I also grant permission to Eurosport Performance's employees to operate the above stated vehicle for the purpose of testing and or inspection. I understand and agree that to secure payment for the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and further agree to pay reasonable attorney's fees and court costs in the event that legal action becomes necessary to enforce this contract.

<b>Total</b>	<b>\$890.22</b>
--------------	-----------------

# RimPRO Inc.

5 Progress Ave  
Tyngsboro, MA 01879

## Estimate

Phone: 978-649-6100 Fax: 978-649-7500	DATE	ESTIMATE #
	4/8/2019	28742

NAME / ADDRESS
Euro Sport Performance 414 Lowell Street Wakefield, MA 01880

DUE DATE	REP
4/8/2019	

ITEM	DESCRIPTION	QTY	COST	TOTAL
TRUE18-19"	Re-True 18" & 19" Wheel: 18" Mercedes 5 spoke (rears) with caps and sensors	2	139.00	278.00
REF18-19"	Refinish 18" & 19" Wheel (excludes hyper): 18" Mercedes 5 spoke (fronts) with caps and sensors	2	209.00	418.00
DELIVERY	Delivery	1	5.00	5.00
	Customer: Chris French - 978-835-3613			

Valve Caps and Valve Stems -- Our standard practice on re-finished wheels for which we are also asked to mount a tire is to replace the stem and cap with a new standard stem and cap. IF YOU WANT TO RETAIN or EXACTLY MATCH YOUR ORIGINAL CAP and/or stem, you must request that now and have it added to the estimate as special instructions.

Any wheel can crack during straightening. We are not responsible for cracked wheels, but will not charge you in the instance they do.

**\*\*WHEELS LEFT OVER 14 DAYS WILL BE RECYCLED\*\***

Please be aware that if you cancel or change all or part of the authorized work described in this estimate after work has commenced, you may incur a cancellation or re-stocking fee. Terms and Conditions for Estimates are posted in our customer lobby and on our website, [www.rimpro.com/estimates](http://www.rimpro.com/estimates).

(6.25%)	\$0.00
<b>TOTAL</b>	<b>\$701.00</b>